



QCC5171 USB debug driver Install and update FW

1. PC system: Win10
2. Install InstallBlueSuiteCda_3_3_13_1423, Click Next until finish install.

名称	修改日期	类型	大小
InstallBlueSuiteCda_3_3_13_1423.exe	2022/4/4 18:10	应用程序	128,862 KB
README.TXT	2018/7/10 9:51	文本文档	1 KB


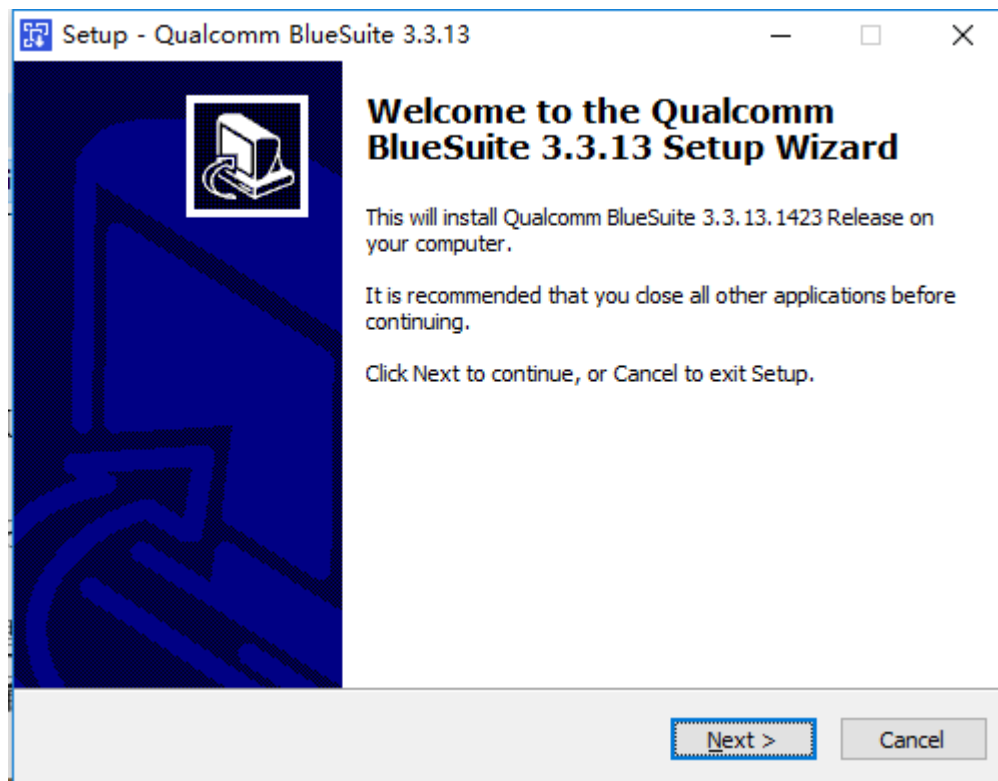




3. Use USB A to A cable (BT/WIFI upgrade cable) connect 4329P with PC
5. Power on device and open PC device manager, and run “bt upgrade enable” command in serial port to enable BT upgrade mode. You will see a new unknown device or USB hub device. If show is USB hub device, you can click detail and see USB HW ID show “VID_0A12&PID_4010” to confirm.

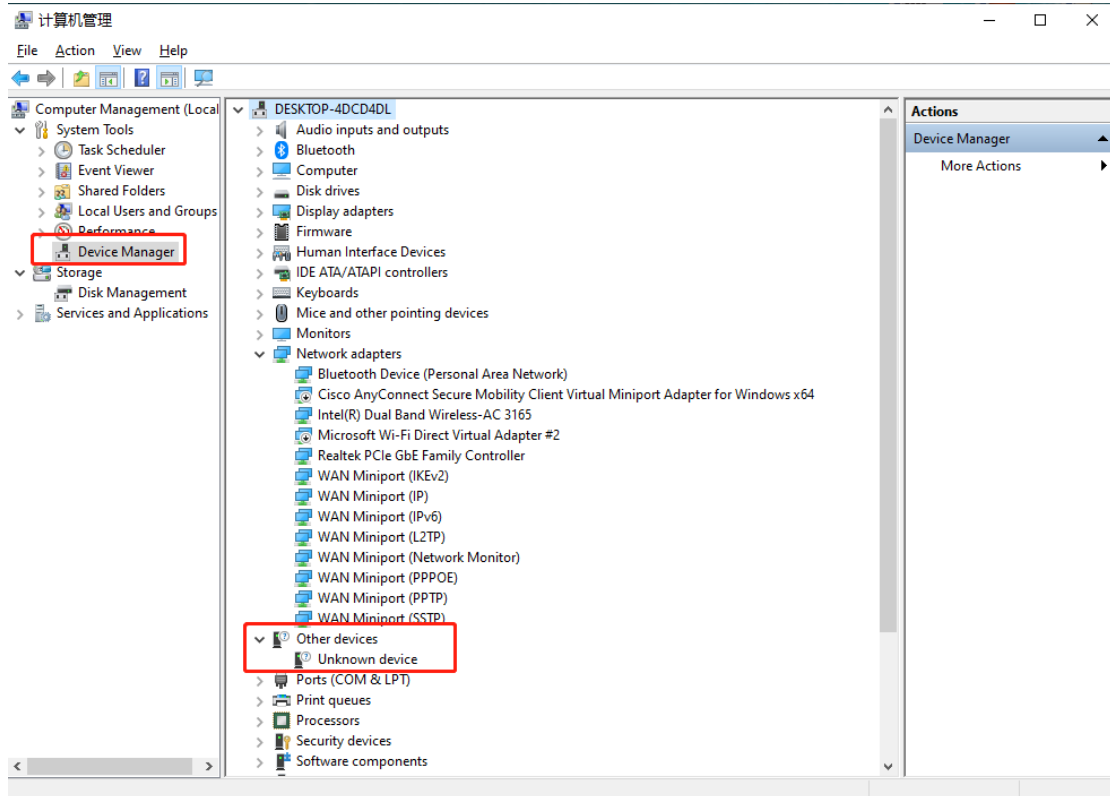





6. Right click this device and choose update driver. Follow below picture red box click to operate.

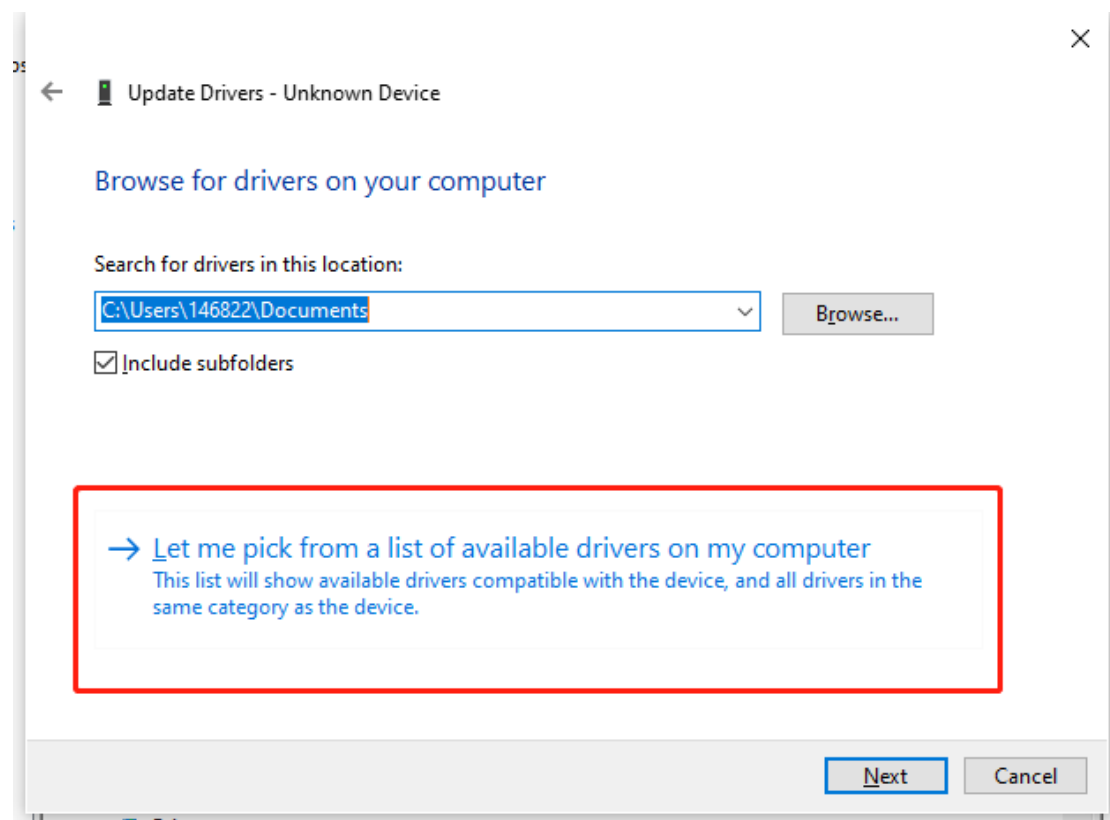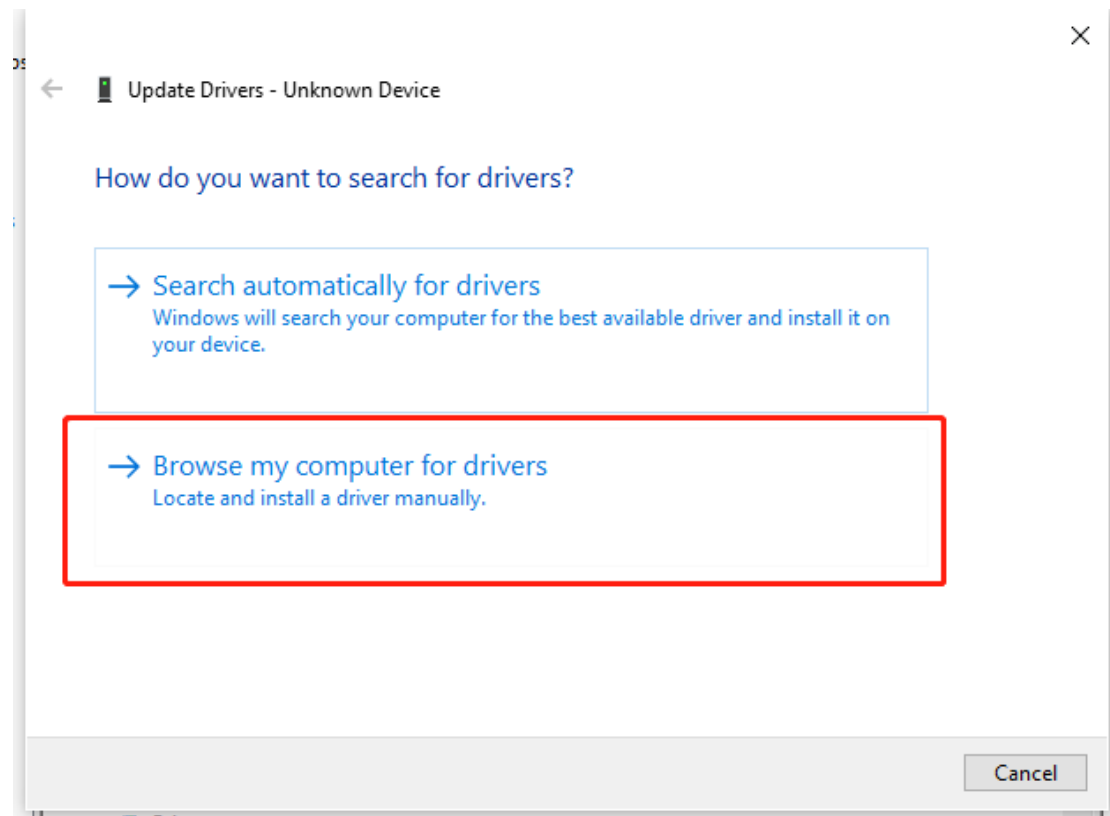

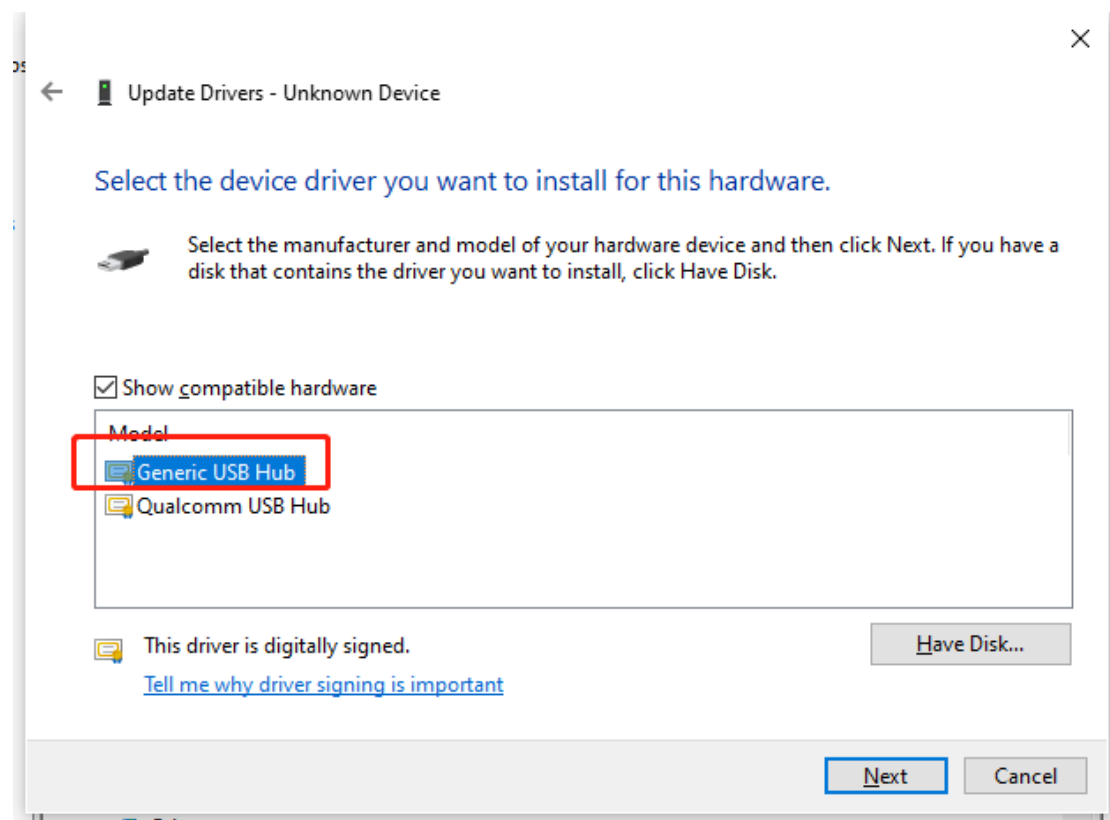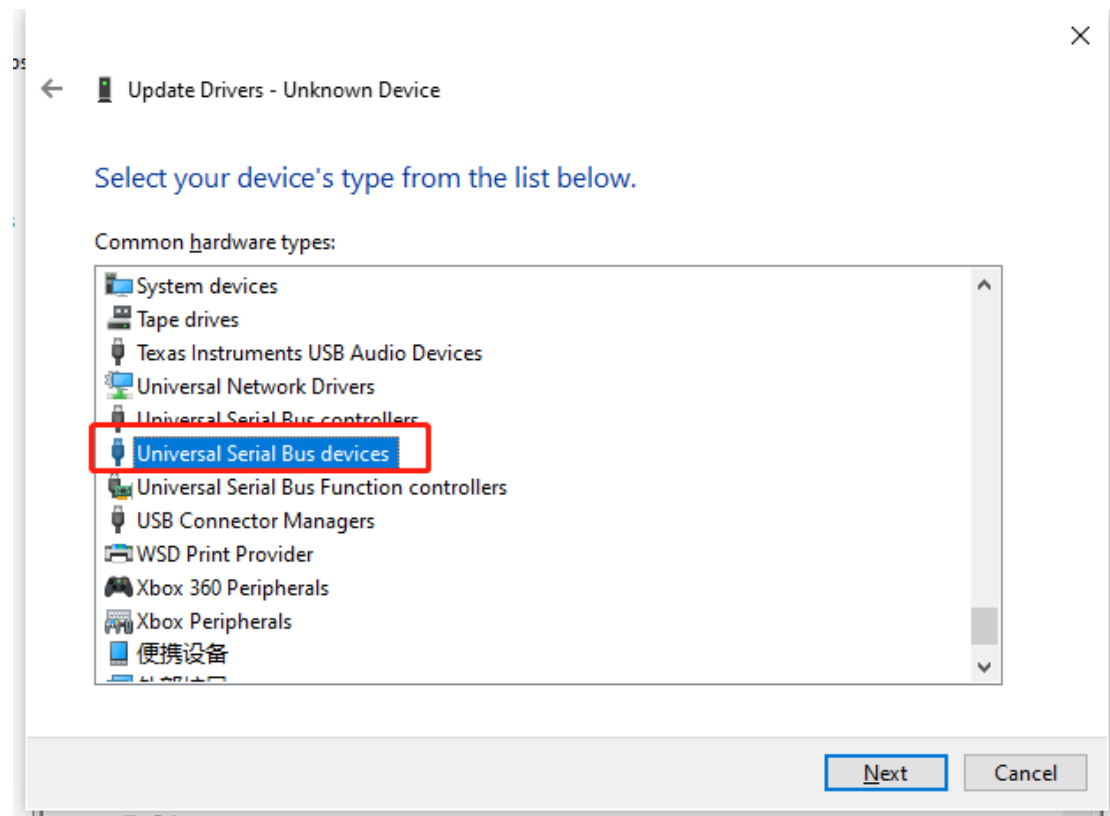

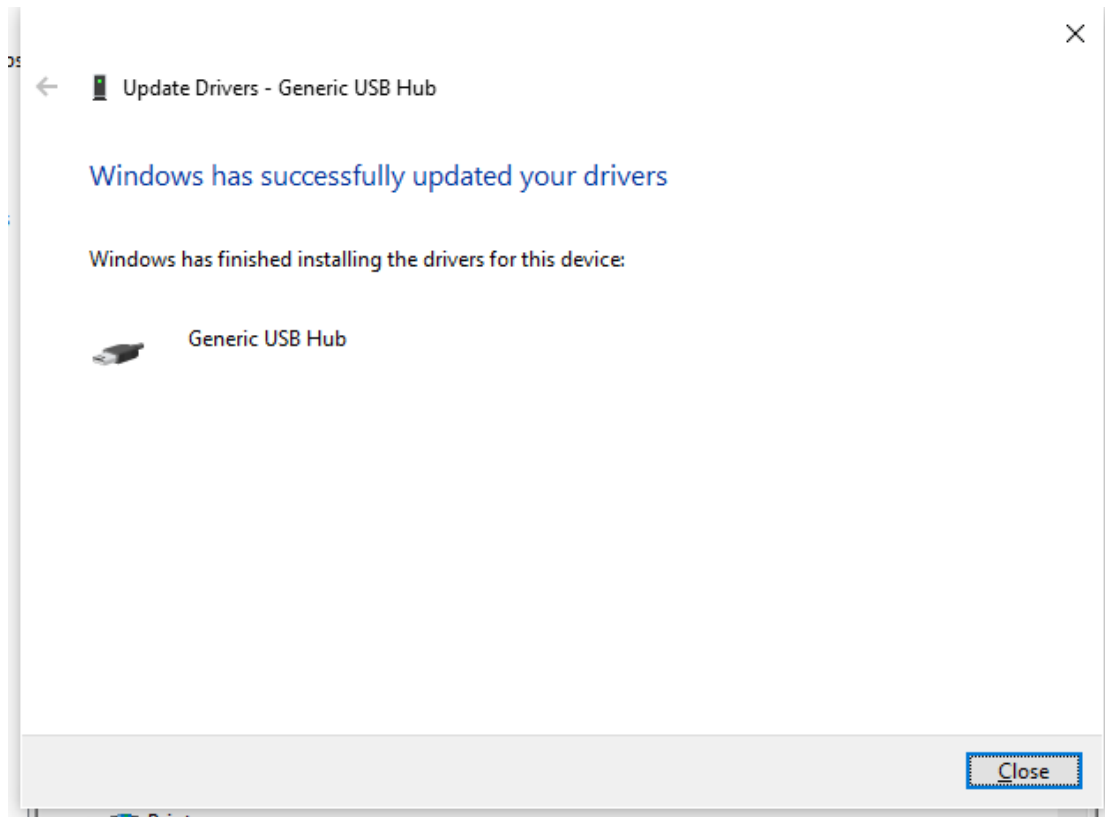


7. If driver install successful, device name show as below (Ignore suffix number 0100). If fail, please repeat step 5 until install successful.

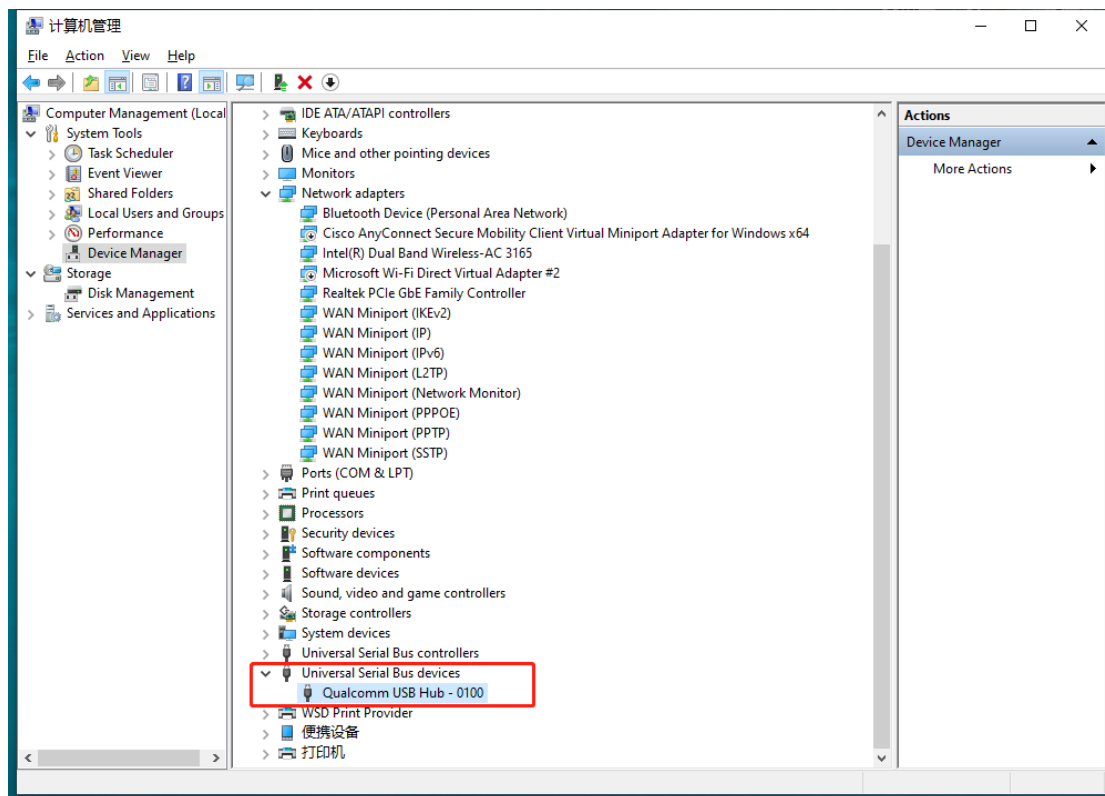


8、Register the driver:

(1) Modify key.bat, ensure the path is same as your driver install path in step 2.

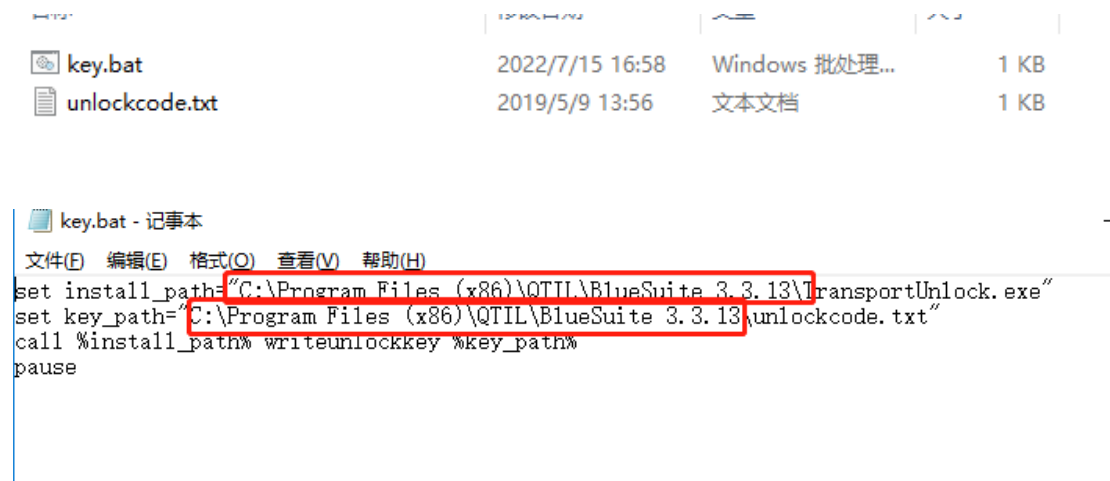

(2) Copy key.bat and unlockcode.txt to driver install path in step 2

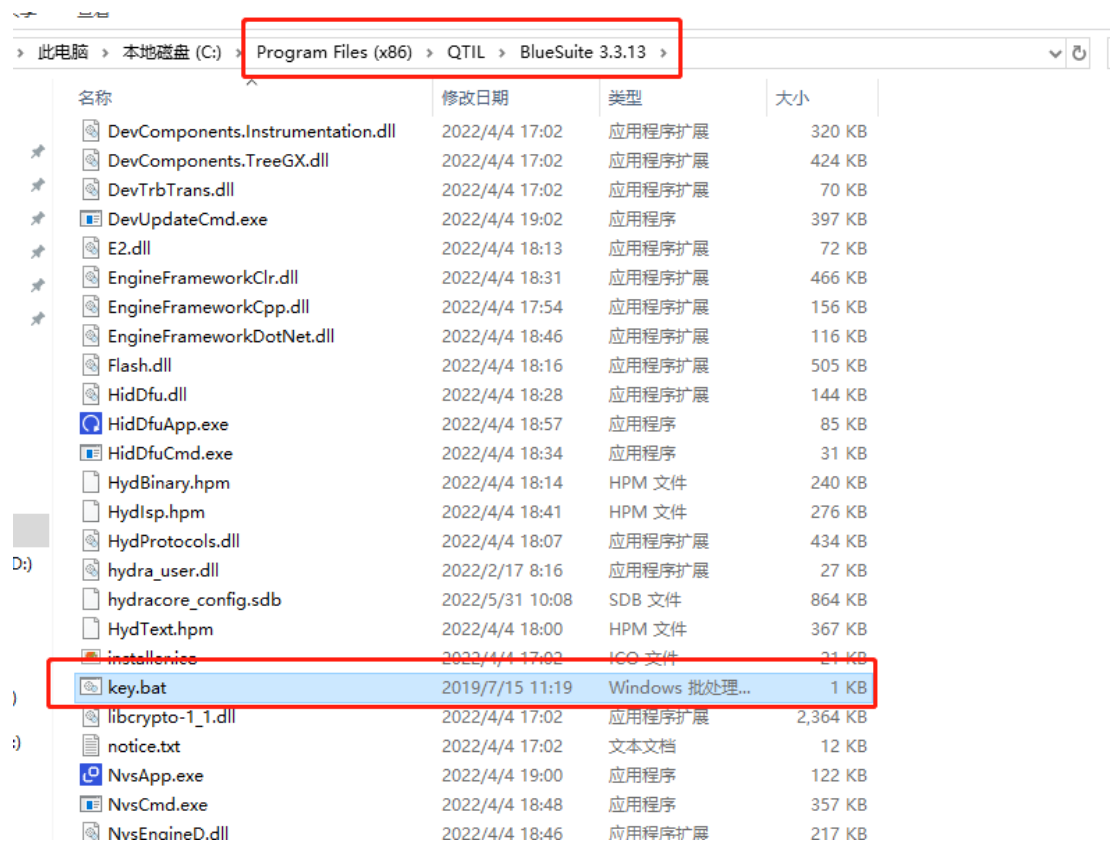


(3) Run Key.bat as administrator, check success ore not

```
C:\Windows\system32>set install_path="C:\Program Files (x86)\QTI\BlueSuite 3.3.13\TransportUnlock.exe"
C:\Windows\system32>set key_path="C:\Program Files (x86)\QTI\BlueSuite 3.3.13\unlockcode.txt"
C:\Windows\system32>call "C:\Program Files (x86)\QTI\BlueSuite 3.3.13\TransportUnlock.exe" writeunlockkey "C:\Program F
iles (x86)\QTI\BlueSuite 3.3.13\unlockcode.txt"
TransportUnlock, version 3.3.13.1423 Release
Copyright (c) 2010-2022 Qualcomm Technologies International, Ltd.
All Rights Reserved.
Qualcomm Technologies International, Ltd. Confidential and Proprietary.



<output key file> not given for "writeunlockkey" - defaulting to 'C:\Users\146822\AppData\Roaming\QTI\KeyFile.txt'
Key file written for USBDBG
Registry setting written for USBDBG
Success
C:\Windows\system32>pause
Press any key to continue . . .
```

9、Plug USB-A cable again, identify Qualcomm driver correctly as below.

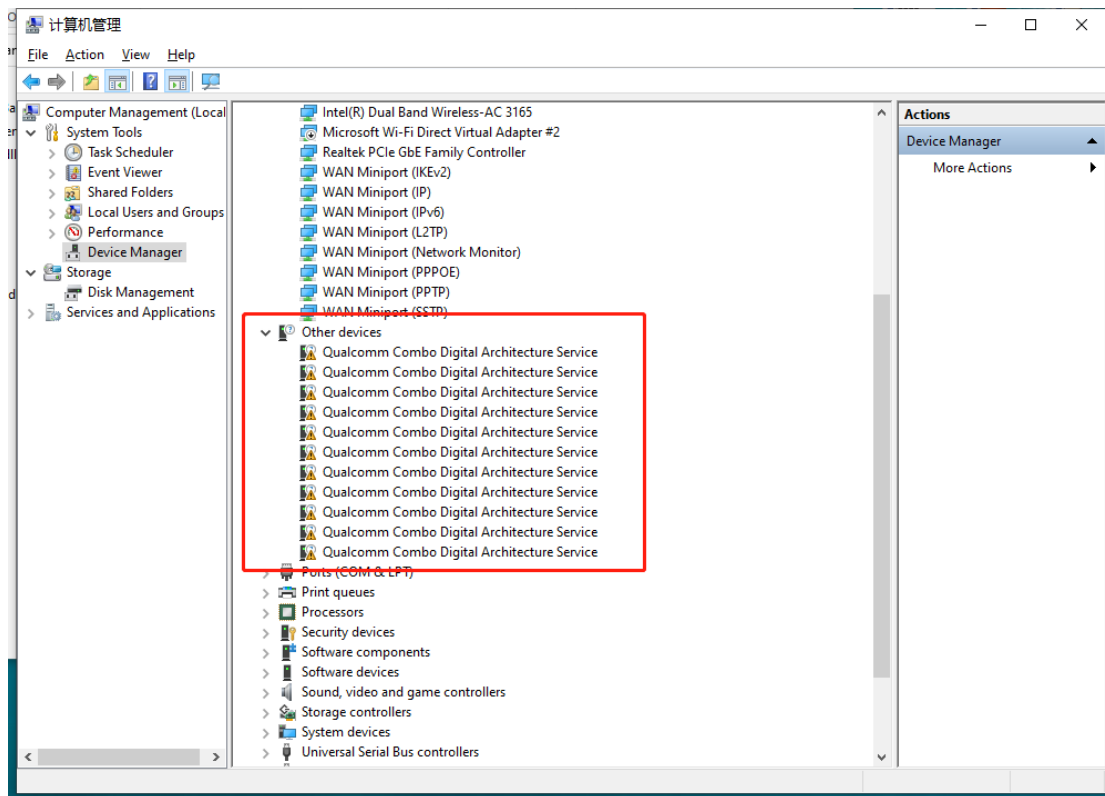


10 Update BT FW


(1) Run jiashi_update_tools_qcc3040_46_5144_0430.exe. Click load file to choose BT FW

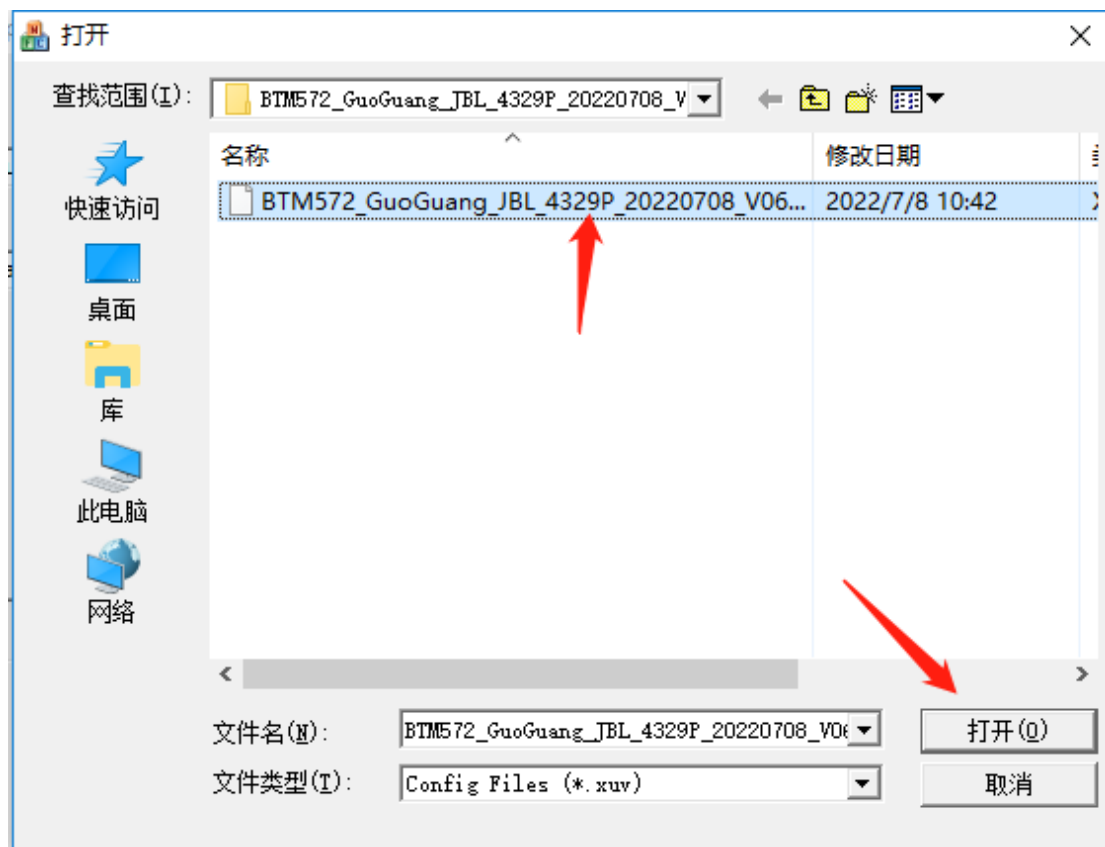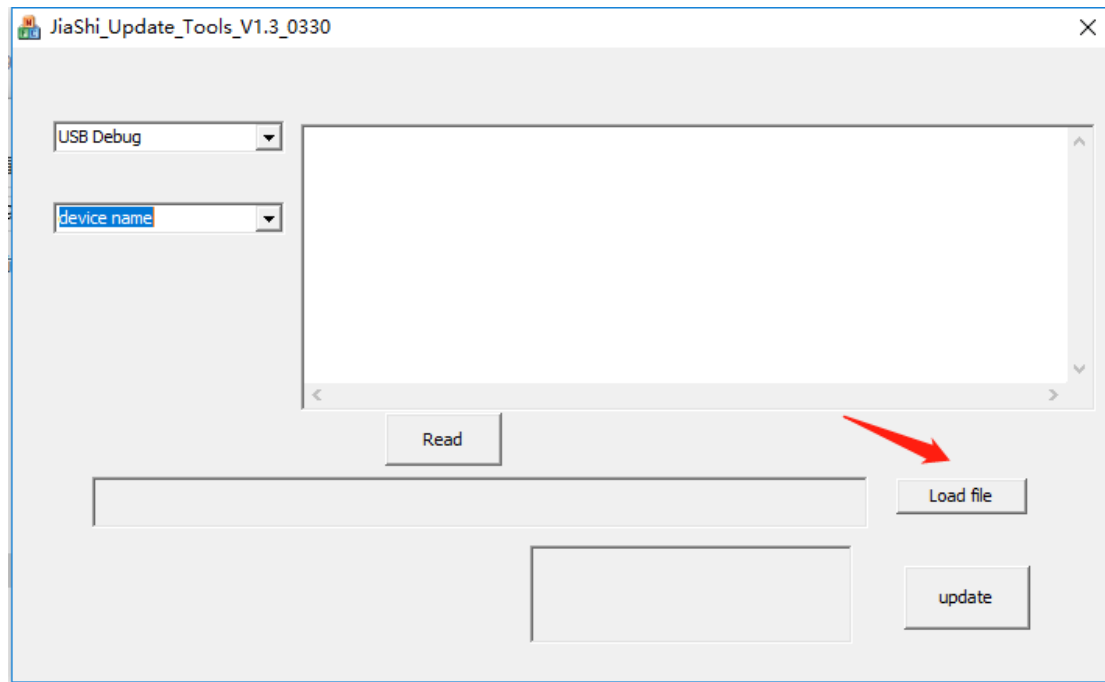

(2) Click Update to update FW

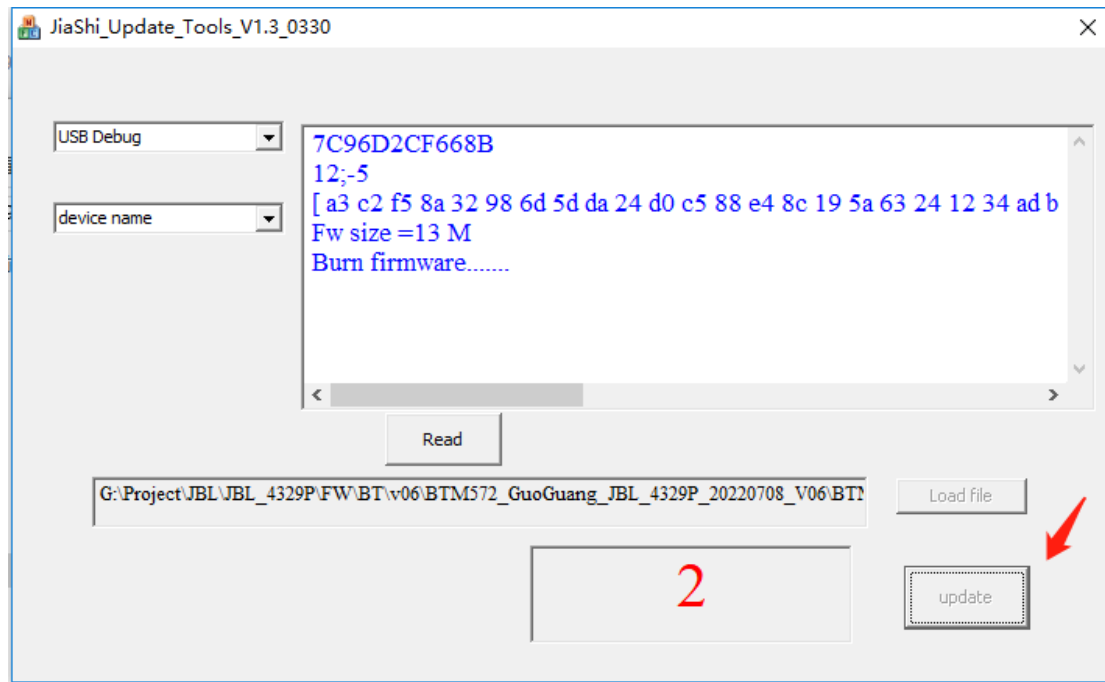

(3) Wait show PASS and update firmware success.

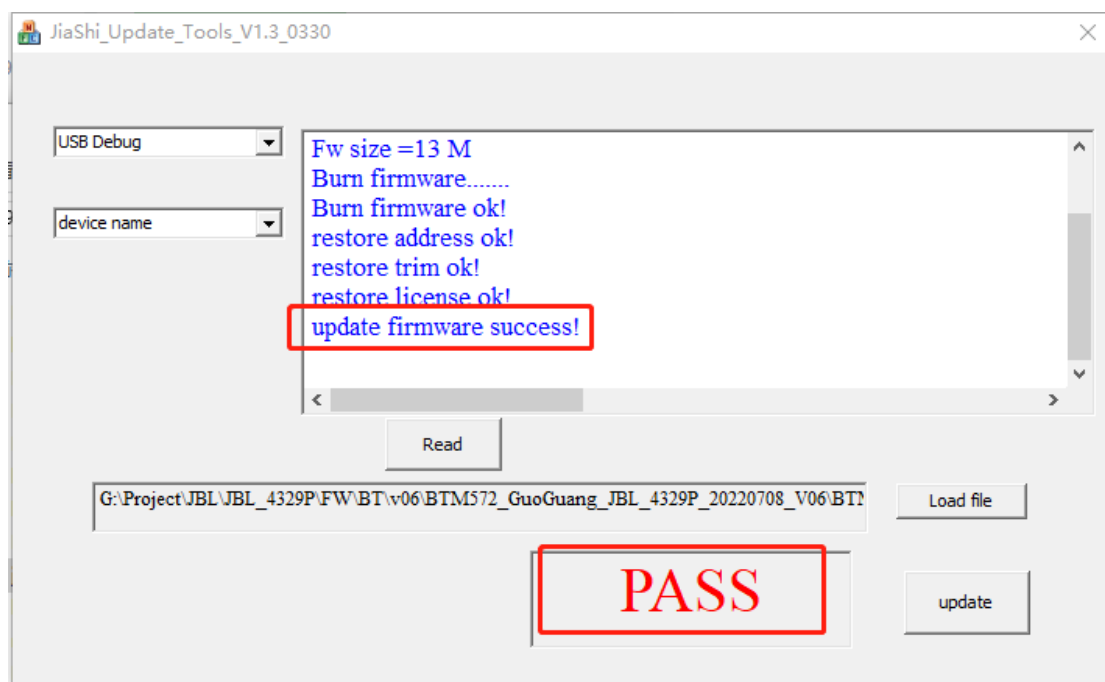

(4) Remove USB-A BT upgrade cable. And then Reboot device, when boot up finish, input "version" command in MCU UART port, can check BT version.

```
JBL #  
JBL # version  
  
WIFI-version: 0.100.1590  
SW Phase: EV  
HW Phase: EV  
MCU BL : 0.0.1.5  
MCU APP: 0.22.28.1  
DSP : 0.1.7  
WTSN TY: 208.3  
BT : 0.0.0.6  
SLAVE : 0.0.0.0  
  
JBL #
```